

Cab mounting bracket No.3 Removal and Installation





Note :

- Welding method is the same on both sides.




Removal :

1. Use a belt sander or the like, scrape off the rivet crimp to remove the cab mounting bracket No.3.

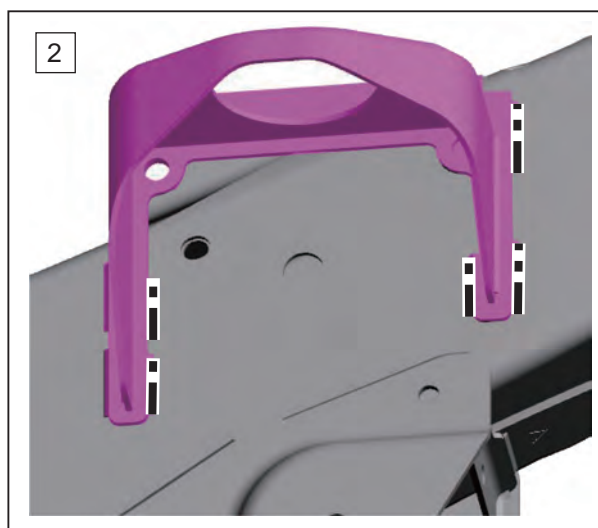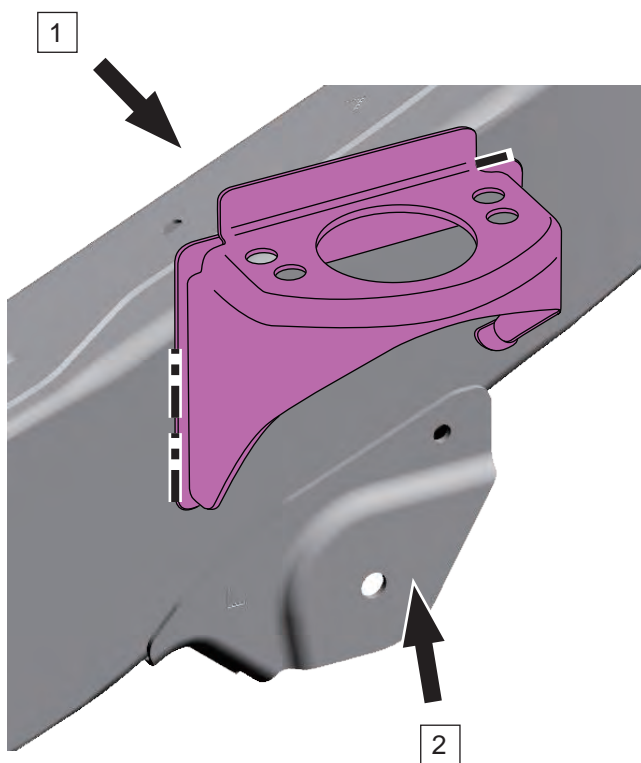

Installation :

1. Install the cab mounting bracket No.3.
2. Conduct fillet weld.

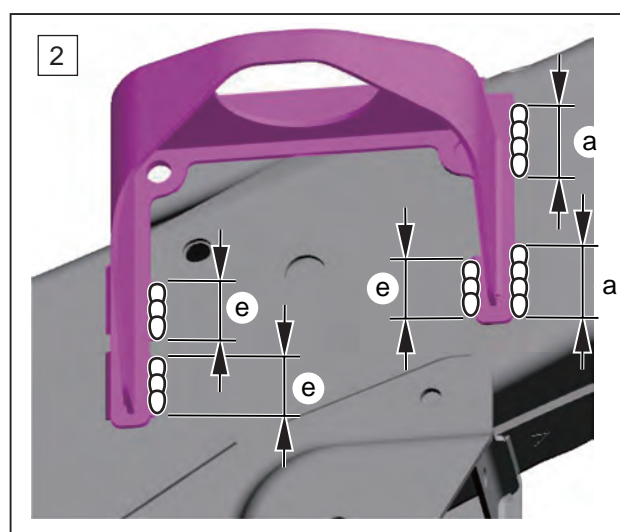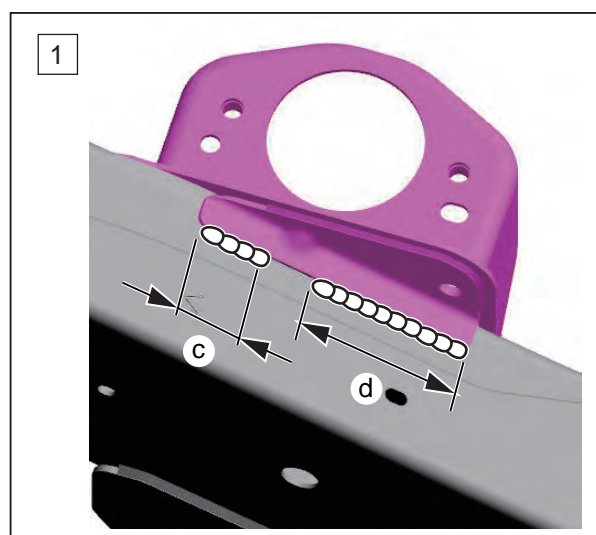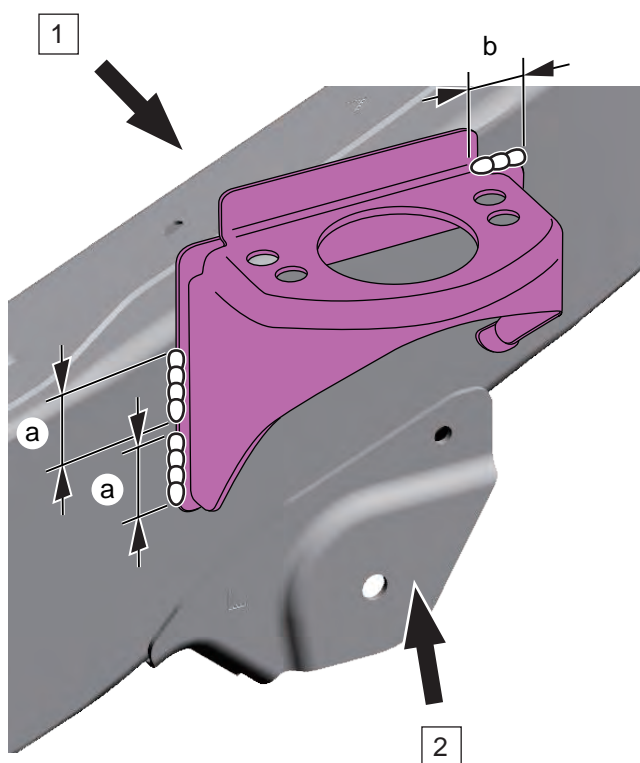

- a. 35 mm {1.38 in}
- b. 15 mm {0.59 in}
- c. 32 mm {1.26 in}
- d. 79 mm {3.11 in}
- e. 30 mm {1.18 in}